

Oyster Creek Generating Station Route 9 South PO Box 388 Forked River, NJ 08731 www.exeloncorp.com

Nuclear

10 CFR 50.73

January 21, 2009 RA-09-008

U. S. Nuclear Regulatory Commission Attn: Document Control Desk Washington, DC 20555 - 0001

Oyster Creek Nuclear Generating Station Facility Operating License No. DPR-16 NRC Docket No. 50-219

Subject:

Licensee Event Report 2008-001-00, Automatic Reactor Shutdown

Caused By Main Transformer Failure

Enclosed is Licensee Event Report 2008-001-00, Automatic Reactor Shutdown Caused By Main Transformer Failure. This event did not affect the health and safety of the public or plant personnel. This event did not result in a safety system functional failure. There are no new regulatory commitments made in this LER submittal.

If any further information or assistance is needed, please contact Richard Milos, Regulatory Assurance at 609-971-4973.

Sincerely,

T.S. Rausch

Vice President, Oyster Creek Nuclear Generating Station

Enclosure:

NRC Form 366, LER 2008-001-00

CC:

Administrator, USNRC Region I

USNRC Project Manager, Oyster Creek

USNRC Senior Resident Inspector, Oyster Creek

File No. 09035

ITEAQ HRA

	RM 366			U.S. NU	CLEAR RE	GULATOR	RY COMMI	SSION	PPROVE	D BY OMB:	NO. 3150-0104	4 E	XPIRES:	08/31/2010
U.S. NUCLEAR REGULATORY COMMISSION (9-2007) LICENSEE EVENT REPORT (LER) (See reverse for required number of digits/characters for each block)								re lic N e- a B co	Estimated burden per response to comply with this mandatory collection request: 80 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records and FOIA/Privacy Service Branch (T-5 F52), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to infocollects@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202, (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.					
1. FACILITY NAME Oyster Creek, Unit 1								2.		T NUMBE 0500021				
4. TITLE Aut		Reacto	r Shutde	own Ca	used By	Main Tr	ansform	ner Failu	re					
5. EVENT DATE 6. LER NUMBER			7. REPORT DATE			· · · · ·	8.	OTHER FACI	ITIES INVOLVED					
MONTH	DAY	YEAR		SEQUENT NUMBE	IAL REV	монтн	DAY	YEAR	FACILITY	NAME	N/A		DOCKET N	I/A
11	28	2008	2008	- 001	- 00	1	21	2009	FACILITY		N/A		<u> </u>	I/A
9. OPER	ATING	MODE	11,	THIS RE	PORT IS	SUBMITTE	D PURSI	JANT TO	THE RE	QUIREME	NTS OF 10 C	FR§: (Check	all that a	ipply)
N			☐ 20.2203(a)(3)(i) ☐ 20.2203(a)(3)(ii) ☐ 20.2203(a)(4) ☐ 50.36(c)(1)(i)(A) ☐ 50.36(c)(1)(ii)(A) ☐ 50.36(c)(2) ☐ 50.46(a)(3)(ii) ☐ 50.73(a)(2)(i)(A) ☐ 50.73(a)(2)(i)(B)				☐ 50.73(a)(2)(i)(C) ☐ 50.73(a)(2)(ii)(A) ☐ 50.73(a)(2)(ii)(B) ☐ 50.73(a)(2)(iii) ☒ 50.73(a)(2)(iv)(A) ☐ 50.73(a)(2)(v)(A) ☐ 50.73(a)(2)(v)(B) ☐ 50.73(a)(2)(v)(C) ☐ 50.73(a)(2)(v)(D)		☐ 50.73(a)(2)(vii) ☐ 50.73(a)(2)(viii)(A) ☐ 50.73(a)(2)(viii)(B) ☐ 50.73(a)(2)(ix)(A) ☐ 50.73(a)(2)(x) ☐ 73.71(a)(4) ☐ 73.71(a)(5) ☐ OTHER Specify in Abstract below or in NRC Form 366A					
					1	2. LICENS	SEE CON	TACT FOR	THIS L	ER				
Michae		one, Sy	stem Er	ngineer					TELEPHONE NUMBER (Include Area Code) (609) 971-2361					
			13. COM	PLETE C	NE LINE	OR EAC	H COMPO	NENT FA	LURE C	ESCRIBE	D IN THIS RI	PORT	,	
CAUSE SYSTEM COM							CAUSE			COMPONENT	MANU-		RTABLE	
CAU	SE	SYSTEM	COMPON	NENT F	MANU- ACTURER			CAL	ISE	SYSTEM	COMPONENT	FACTURER	то	EPIX
X		EL	XFM	R	G080	топ	EPIX Y	CAL N/		N/A	N/A	FACTURER N/A	N	√A
X		EL 14	XFM . SUPPLI	R	G080	TO I	EPIX Y	N/	A	N/A 15. E) SUB	N/A (PECTED MISSION	N/A MONTH	DAY	I/A YEAR
X	S (If yes	EL 14 s, complet	XFM . SUPPLI	R EMENTA PECTED	G080	TO E T EXPECT ON DATE	EPIX Y FED	N/ ⊠ I	A IO	N/A 15. E) SUB	N/A (PECTED	FACTURER N/A	N	√A
YE ABSTRA On diff the SC	S (If yes Novel ferentia M1A CRAM.	EL 14 s, complete ait to 1400 mber 28 al relay a Main Po All safe ere no sa at is bein	XFM . SUPPLI e 15. EXF spaces, i. , 2008 a actuation wer Tra ety syste	EMENTA DECTED The at 2101 The insform opensequely	G080 L REPOR SUBMISSI while op cause of er. This erated as	TEXPECT ON DATE 5 single-si erating a f the diffe transien a expecte	TED paced type at 98% perential interpretation to the period follow lant or period to the period follow the period foll	N/ ewritten lin boower, a relay act a reactor ving the bublic sa	genera uation r auton SCRAI	N/A 15. E) SUBI E ator trip is attributatic shu	N/A RPECTED MISSION DATE occurred du uted to an e utdown due of this ever	N/A MONTH N/A ue to a translectrical fait to a load re	DAY N/A sformer ult interreject	YEAR N/A

NRC FORM 366A

(9-2007)

LICENSEE EVENT REPORT (LER) **CONTINUATION SHEET**

U.S. NUCLEAR	REGULATORY	COMMISSION

1. FACILITY NAME	2. DOCKET	(3. PAGE				
Oyster Creek, Unit 1	05000219	YEAR .	SEQUENTIAL NUMBER	REV NO.	2	OF	3
Oyster Oreek, Office	05000219	2008	- 001 -	00]	Oi .	J

NARRATIVE

Plant Condition Prior to Event

Event Date:

November 28, 2008

Event Time:

2101

Unit 1 Mode: Power Operation

Power Level:

98%

Description of Event

On November 28, 2008, the Oyster Creek Generating Station was operating at 98% reactor power, 646 Megawatts Electric. Oyster Creek had been online for 8 days following the 25 day 1R22 refueling outage. Oyster Creek was operating at slightly reduced power due to a steam leak, which forced the plant to operate with the 2nd Stage Reheaters (RHTR) out of service.

At 2101, Oyster Creek Generator (GEN) tripped due to A-phase and B-phase differential relay (87) actuation, and the Reactor (RCT) automatically shutdown due to a load reject SCRAM. All safety systems operated as expected following the SCRAM. A review of the grid disturbance report provided by Jersey Central Power & Light (JCP&L). Oyster Creek Digital Protective Relay System (DPRS) data, Differential voltage and current indication data, and dissolved gas in oil analysis indicated that the fault occurred on the B phase of the M1A Main Power Transformer (XFMR).

Analysis of Event:

The Post Trip Review Group was convened to review this event. The internal fault of the M1A Main Generator Output Transformer caused a Generator Load Reject Scram. An expected pressurization transient occurred to about 1063 psig. The elevated pressure resulted in Electromatic Relief Valves (EMRV's) A and D opening, both Isolation Condensers (BL) initiated and Reactor Recirc (AD) Pumps (P) A, B, and E tripped. The EMRV's closed as pressure decreased and the Isolation Condensers were manually removed from service. The review determined that the plant responded as designed and operator action was prompt and appropriate. The transient was within the design basis of the plant and had no safety significance.

A visual inspection of the area identified that the H1 lightning arrestor on the M1A transformer ('A' phase) had broken and slumped over, and that the transformer had ejected oil onto the surrounding ground due to its pressure relief valve actuation. The oil ejected from the transformer was cleaned from the surrounding soil. Subsequent electrical testing, and transformer oil gas analysis on the M1A transformer indicated that the fault was internal to the transformer.

Cause of Event:

An electrical fault internal to the M1A Main Power Transformer led to a reactor automatic shutdown due to a load reject SCRAM. Two potential contributing causes were identified.

1. Decisions to disposition expert recommendations made at the wrong level within the organization. Recommendations made by the corporate transformer SME to install continuous gas monitoring on the Main Power Transformers and recommendations resulting from the 2005 material condition assessment report from Doble Engineering, were not implemented. Implementation of these recommendations may have potentially allowed the station to detect the internal M1A fault earlier and allow for a more controlled repair and/or replacement of transformer.

NRC FORM 366A (9-2007)		'ENT REPORT (LER) ^{U.S.} NUCLEAR REGULATORY COMMISSION UATION SHEET						
1. FACILITY NAME	2. DOCKET	6. LER NUMBER			3. PAGE			
Oyster Creek, Unit 1	05000219	YEAR	SEQUENTIAL NUMBER	REV NO.	3	OF	3	
	00000210	2008	- 001 -	00		σ.	J	

NARRATIVE

2. PM Program is inadequate. Main Power transformer electrical testing frequency was not increased from PCM template minimum frequency as appropriate for a transformer of M1A's age and one displaying M1A's other characteristics, as based upon the 2005 transformer assessment report recommendation and recent industry operating experience. Recent Industry OPEX and other guidance have indicated that Exelon's PCM template frequency for conducting main transformer electrical testing may be inadequate to identify transformer degradation prior to failure.

Corrective Actions:

The M1A Main Transformer was replaced with an identical spare unit and the plant returned to power operation on December 6, 2008.

Additional corrective actions center on revising the electrical testing PM frequency, reinforcing system manager roles and responsibilities for decision making, and installation of on-line gas monitors for the two (2) Main Power Transformers.

Previous Occurrences

There have been no similar Licensee Event Report events at Oyster Creek in the last three years.

Component Failure Data

Component: M1A Main Transformer (325 MVA) Manufacturer: GE (Rewind 1989 by Magnetec)

Serial No.# D577930

Cause: Internal Electrical Fault

NRC FORM 366A (9-2007) PRINTED ON RECYCLED PAPER